

## Fire Alarm Inspection and Servicing Certificate

Customer Details			
<b>Customer Name</b>	Tarpорley & District Community Centre	<b>Job Ref</b>	7A129951
<b>Site Address</b>	Tarpорley & District Community Centre High Street Tarpорley CW6 0AY	<b>Date</b>	15/08/2023
Service Details			
<b>Type of Service</b>	Six Monthly		
<b>Percentage Tested</b>	100%	<b>If under 100%, please state the areas tested for this report</b>	
Inspection/Testing Details			
<b>Make of Panel</b>	C Tec	<b>Model type</b>	CFP
<b>Protocol</b>	Conventional		
<b>Battery Size</b>	12V 2.8ah	<b>Number of call points inspected from % tested</b>	9
<b>Is there a second battery fitted?</b>	Yes	<b>Number of detectors inspected From % tested</b>	20
<b>Battery Installation date</b>	01-02-2021 13:36	<b>Number of sounders inspected from % tested</b>	10
<b>Variations from the recommendation of clause 45 of BS5839-1:2013 for periodic or annual inspection and test (as applicable)</b>			
N/A			
<b>The following work/action is considered necessary</b>			
<p>Smoke detector in lobby outside male toilets triggers a fault on panel when activated rather than causing a fire condition. Requires replacement s65 smoke detector.</p> <p>Heat sensor in both boiler rooms is a high threshold sensor which cannot be tested with the usual heat sensor. Please replace with lower threshold heats as customer requires confirmation of testing for these areas.</p>			
<b>The following items were found to be defective and were resolved at the point of service</b>			
Signing Off			
<b>Technician</b>			
<b>Customer</b>	Tony Yeates	<b>Signature</b>	/

